

## Improvements and bug fixes:

- V48 is an alternative CAN SW version with modified start- and shutdown behaviour. With the V48, device will start up when the ignition is switched on. Device shuts again down when key is removed from the vehicle ignition lock. On vehicles with "Keyless Access" function, device will shut down after switching the ignition off and opening of the driver's door.

## Requirements:

- USB stick of at least 4 GB data size.  
Note: The USB stick must be formatted to FAT32 before use (right-click on the USB drive in the Win Explorer → choose "Format" → select FAT 32 → start).  
Warning: Formatting will delete all files on USB drive.
- A Windows based PC or notebook to prepare the USB stick.

## Installation of the software update:

1. Download the software update package "Z-E2026\_CAN\_SW\_V48.exe".
2. The software package is a self-unzipping executable. Start extraction by double-clicking and selecting your USB stick as target for the uncompressed files.
3. You obtain a folder called "C10\_SW\_Update" in the root directory of the USB stick.
4. Connect the USB stick to your naviceiver.
5. Enter the naviceiver setup. Tap on "Device Setup" → "Help" → "Software Update" → "OK".
6. The naviceiver will restart and show the update dialog menu.
7. Make sure, checkbox "CAN" is selected. If so, tap on the "Update" button to start the update process.
8. Your system will be updated in a step-by-step process. The complete update procedure takes approx. 3 minutes. A status bar shows the update progress.
9. Once the update process has completed successfully, please restart device by pressing the RESET button.
10. Remove the USB stick.

## Final Initialisation:

To assure the CAN interface will function correctly in the electrical vehicle environment, disconnecting the car battery to allow the CAN interface to reinitialize completely once the software update has completed, is mandatory. Disconnect the battery for approx. 15 minutes by removing the negative battery clamp.

**Important:** Make sure the antitheft function of the device is disabled, before you disconnect the battery!

## It is not possible to apply the update?

If the update process will abort with an error message, the CAN interface must be restarted first. The restart of CAN interface can be achieved by either turning off the ignition, leave and lock the car for 15 minutes, until all control units of your car will shut down. Or disconnect the battery for approx. 15 minutes. If further attempts will fail, too, consider the use of another USB stick model, since the current used USB stick might be not compatible.