

Requirements:


Note: This is FULL MainSystem Software update via USB drive (MCU/ OS/ APP)

- USB stick with at least 2 GB memory.
- A Windows based PC or notebook to prepare the USB.
- **Please use USB-1 (USB Port 1) for the software update.**

Note: The USB stick must be formatted to FAT32 before use (right-click on the USB drive in the Win Explorer → choose "Format" → select FAT 32 → start).

Installation of MainSystem Software Update via USB drive:

1. Download the software update package „Z-N326_FEU_SW_v171213.exe“.
2. The software package is a self-unzipping executable. Start extraction with a double-click and select your USB stick as target for the uncompressed files.
3. You obtain four files called [ATC8317.bin] – [ATC8317.ini] – [hkApp.bin] – [MCU.bin] in the root directory of the USB stick.

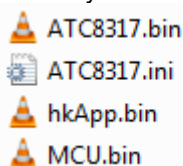

4. Connect the USB stick to your powered ON naviceiver at USB Port-1 (**USB-1**).
5. Enter the naviceiver setup. Tap on "Setup" → "Software Update" → "YES".
6. Your system will be updated the new software in a step-by-step process. The complete update procedure takes approx. 2~4 minutes. A status bar shows the update progress.
7. Remove the USB stick if naviceiver show the message „**APP Update successfully installed. Please reboot the system,,!**“
8. Please restart your ZENEC naviceiver by ACC Power OFF → ON or by press the RESET button.
9. The device reboots and the ZENEC bootlogo is displayed for 30 ~ 50 seconds, then the device automatically switches to the TUNER source and is ready for operation again.
10. Please do a versions check.

Version checking:

After completion of the software update, version checking is crucial to validate full success. If the installed software version differs with listed versions below, a full re-installation of the entire software update is required.

Review of device software version:

To check the Main Software Version, enter the naviceiver setup. Tap on "Device Setup" → "Help" → "Version Info".

Version:	171213
MCU:	RN_6V53V1.89-171213
OS:	AC83_V1.01.0017.05-2S-171128
AP:	RN6V53-V1.3.5-171127

Notes:

- Do not operate or turn off while device is performing a software update.
- Don't use USB-Port 2 (USB-2) for any MainSystem Updates. USB-2 don't support software updates.

Improvements and bug fixes:

MainSystem General

- Improved system stability and performance

MediaPlayer

- Bugfix for Last Playback problem in combination with USB drive – HU always switch to the USB Source
- Bugfix for Cover art display with iPhone 7 - can't display album Cover with iPhone 7

ZENEC Smart-Link

- ZENEC Smart-Link update for Apple iPhone with iOS 11.x (once again fully functional)

Audio Setup

- Improved Balance and Fader display in Audio Setup Settings

TUNER

- Improved TA logic and function